 
Instruction Manual

(1) Remove the Cable tie before installation.




Insert cable into strain relief boot, strip off 1.2 inch of cable jacket ,fold back braid and drain wire.


JACK PIN DESIGNATIONS		TIA/EIA T568A	TIA/EIA T568B
	1 2	White/Green Green	White/Orange Orange
	3 4	White/Orange Blue	White/Green Blue
	5 6	White/Blue Orange	White/Blue Green
	7 8	White/Brown Brown	White/Brown Brown

Boot adjustment

 
Cut the end of boot to fit your cable OD.




 
Fan out all four twisted pairs, following the color coding label and allocate each conductor into proper slots on wiring cap. Trim the ends of conductors.



Place wiring cap on plug.

 

 

 

Close plug cover, make sure the drain wire is in proper contact with grounding clip on plug. Pull back strain relief boot to cover the plug, fasten supplied cable tie to secure grounding contact.



